


Wireless Charging Protection System

Assembly instructions WCPS Raised floor




Assembly

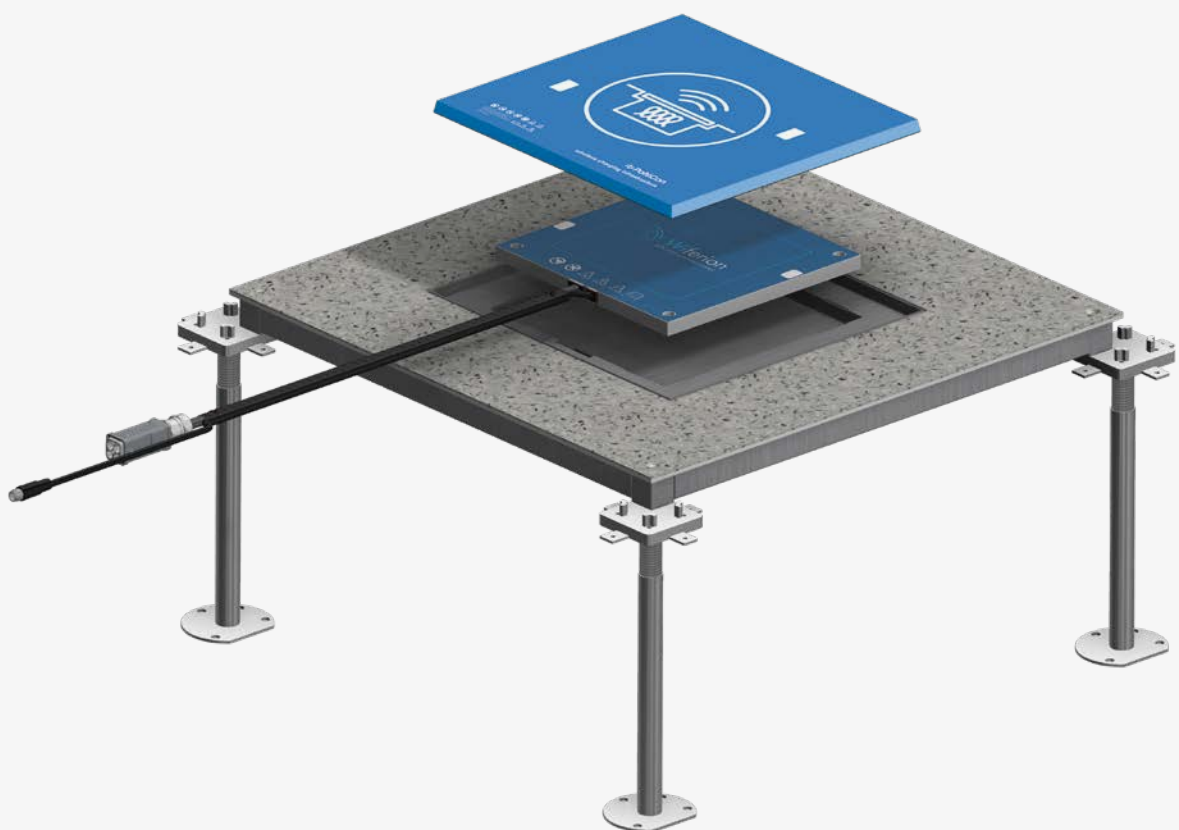


1 Removing the base plate at the desired loading point in the cleanroom.



2 Installation of the WCPS raised floor onto the existing supporting structure.

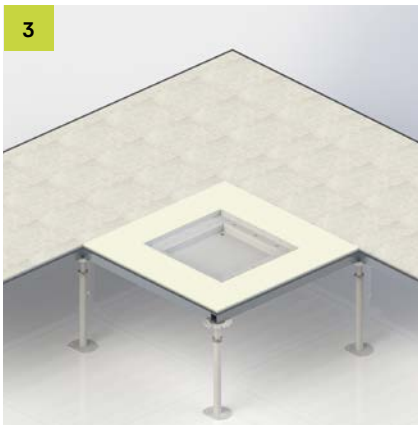

3 If necessary, bolt the WCPS raised floor to the supporting structure.

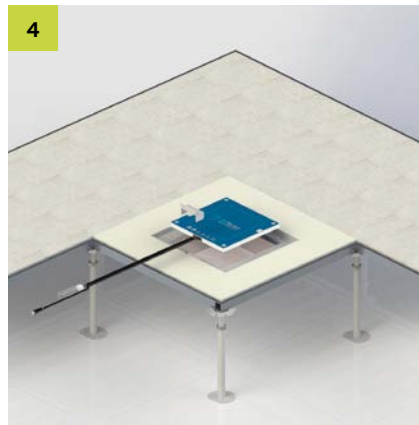

4 Inserting the etaLink3000 charging pad.* The cable must be carefully fed through the opening provided for this purpose in the charging enclosure and to the wallbox*.



5 The charging pad must lie flat in the cassette unit and must not wobble.



6 Fit the PCX cover and seal the edges with a suitable sealant.



7 Depending on the internal cleanroom regulations, the information sticker should be affixed to the cover. The maximum load capacity of the WCPS raised floor is specified as 5 kN.

* Wiferion products are not included in the scope of delivery. The charging electronics must be commissioned by a qualified technician.

Safety instructions

We recommend that the WCPS product be installed only by integrators certified by PohlCon or under the supervision of a PohlCon site manager. Improper and unprofessional installation and resulting consequential damage will lead to the exclusion of warranty claims.

We recommend the use of suitable protective gloves.



Observe safety instructions



Read mounting instruction completely



Document the installation

The sticker instructions on the charging pad must be observed

Wireless Charging Protection System



1



2



3



4



5



6



7





8



9



10



Fläche freihalten von metallischen Objekten.
Keep the area free of metallic objects.
Mantenga el área libre de objetos metálicos.
Gardez la zone exempte d'objets métalliques

wcps.pohlcon.com

1. No heavy load
2. No access for persons with pacemakers or implanted defibrillators
3. No access for persons with implants made of metal
4. No reaching in
5. No entry

6. Warning against non-ionizing radiation
7. Warning against hot surface
8. Observe important information in the Mounting instruction
9. Warning of electrical voltage
10. General warning



You want to become a certified integrator?
You can find more information on:
wcps@pohlcon.com

All rights reserved. This document may not be reprinted or electronically reproduced without our prior written permission. Content subject to technical change without notice. Errors and omissions excepted. The publisher shall assume no liability, irrespective of the legal grounds for this. This document supersedes all previous documentation.

© PohlCon | PC-LIT-MA-WCPS-DB-EN | 05-2026 | 1. | 05-2026

PohlCon GmbH

Nobelstr. 51
12057 Berlin
Germany

T +49 30 68283-04
F +49 30 68283-383

www.pohlcon.com